

Manhole Inspection Summary

Manhole # S08EE_015MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **08EE** Node: **015** Status: **Found**

Insp Date: **2/9/09 1:21 PM**

Incomplete Comments

Crew: **TJ CB**
Inspector: **Johnson**
Firm: **URS**

Location Address: **5201 N FRANKLINTOWN RD** Cross Street: **N FOREST PARK AVE**

Manhole Type: **Junction** Location: **Easement / Right of Way** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **012 PIPE SEAL/ BENCH/ CHANNEL INFILTRATION RUNNER**

Cover Shape: **Circular** Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **12** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☒ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☒ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☒ Parged

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Deteriorated ☒ **Leaks** ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Deteriorated ☒ **Leaks** ☐ Debris

Steps Count: **7** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View




Top View



FRAME SEAL GASKET



Defect 1

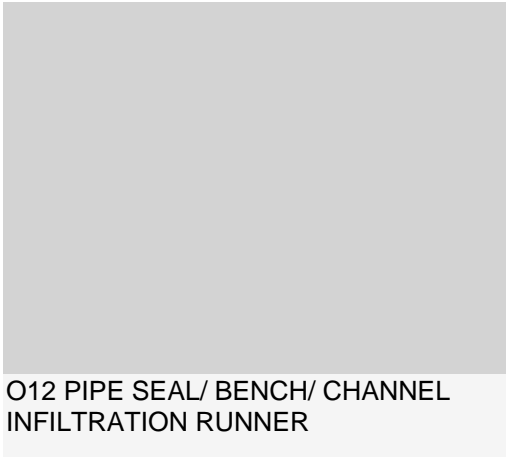


O12 PIPE SEAL/ BENCH/ CHANNEL
INFILTRATION RUNNER

Defect 3



BARREL INFILTRATION

Defect 2

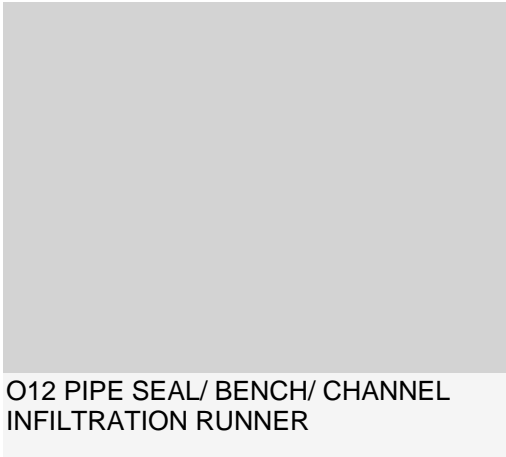

O12 PIPE SEAL/ BENCH/ CHANNEL
INFILTRATION RUNNER

Manhole Inspection Summary

Manhole # S08EE_015MH

Printed On: 6/24/2010

Page 3 of 3

24 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **12.46** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

24 in. Circular Gravity Sewer
Pipe In @ 7 O'Clock

7 O'Clock Inflow



Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **12.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **County (No manhole in GIS)**

☐ Possible Illicit Connection